

# FMRS3000

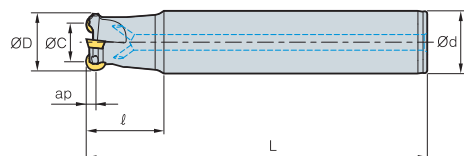


Рис. 1

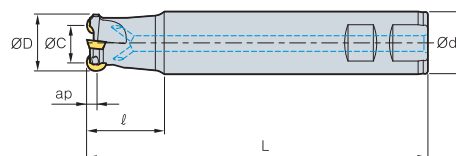


Рис. 2



- AR : 5°
- RR : -8°~5°


(мм)

Обозначение		ØD	ØC	Ød	ℓ	L	ap		Рис.
<b>FMRS 3021HRD-M</b>	1	21	11	20	40	150	5	0.4	1
<b>3021HRD-M2</b>	2	21	11	20	40	150	5	0.4	1
<b>3021HRD-L</b>	1	21	11	20	50	200	5	0.6	1
<b>3021HRD-L2</b>	2	21	11	20	50	200	5	0.6	1
<b>3025HRD-S</b>	2	25	15	25	35	115	5	0.5	2
<b>3025HRD-M</b>	2	25	15	25	70	200	5	0.7	1
<b>3025HRD-L</b>	2	25	15	25	100	250	5	1	1
<b>3026HRD-M</b>	2	26	16	25	70	200	5	0.65	1
<b>3026HRD-L</b>	2	26	16	25	100	250	5	0.7	1
<b>3032HRD-S</b>	3	32	22	32	40	125	5	1	2
<b>3032HRD-M</b>	3	32	22	32	70	200	5	1.3	1
<b>3032HRD-L</b>	3	32	22	32	150	300	5	1.6	1
<b>3040HRD-S</b>	4	40	30	32	40	125	5	1.3	2
<b>3040HRD-M</b>	4	40	30	32	70	200	5	1.5	1
<b>3040HRD-L</b>	4	40	30	32	150	300	5	1.8	1

## Применяемые СМП

Обозначение	RDKT-MF				RDKT-MM				RDCT-MA				Стр.					
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20		CN30	H01	G10	ST30A	ST20
RDCT 10ТЗМ0-MA																		
RDKT 10ТЗМ0-MF																		
10ТЗМ0-MM	●	●		●	●	●	●	●										

## Комплектующие



FTGA03508(07)



TW15S