


АМС(М)2000М

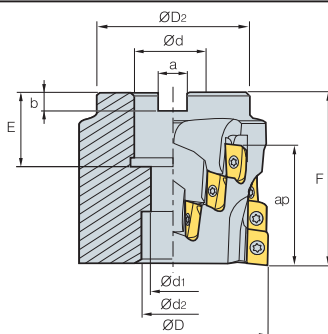

AA 90°
 • AR : 9°
 • RR : -9°~5°

Обозначение		ØD	ØD ₂	Ød	Ød ₁	Ød ₂	Ød ₃	a	b	E	F	Количество зубьев	ap		
АМС(М) 2050М		16	50	40	22.225(22)	11	18	-	8(10.4)	5(6.3)	29(21)	58	4	39	0.7
2063М		16	63	50	25.4(27)	13.5	20	-	9.5(12.4)	6(7)	25(25)	58	4	39	0.8
2080М		20	80	60	31.75(32)	-	45	-	12.7(14.4)	8(8)	35(28)	63	5	39	0.96
2100М		24	100	80	38.1(40)	-	56	-	15.9(16.4)	10(9)	38(30)	63	6	39	1.2

(мм)

• () Метрическая система

Применяемые СМП

APMT-MM

APMT-MF



Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.		
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A	ST20
APMT 11T3PDSR-MM	●		●	●	●	●	●											E05
11T3PDSR-MF	●		●	●	●	●												
11T308PDSR-MM	●		●	●	●	●												
11T312PDSR-MM	●		●	●	●	●												
11T316R-MM	●		●	●	●	●												
11T318R-MM			●	●	●	●												
11T324R-MM			●	●	●	●												


Применяемые оправки

Обозначение	Ød	Оправка с хвостовиком ВТ	
АМС(М) 2050М	22.225	BT□□-FMA22.225-□□	BT□□-SMA22.225-□□
	22	BT□□-FMC22-□□	BT□□-SMC22-□□
2063М	25.4	BT□□-FMA25.4-□□	BT□□-SMA25.4-□□
	27	BT□□-FMC27-□□	BT□□-SMC27-□□
2080М	31.75	BT□□-FMA31.75-□□	BT□□-SMA31.75-□□
	32	BT□□-FMC32-□□	BT□□-SMC32-□□
2100М	38.1	BT□□-FMA38.1-□□	BT□□-SMA38.1-□□
	40	BT□□-FMC40-□□	BT□□-SMC40-□□

Рекомендации по выбору СМП



Комплектующие



FTKA02565S

TW08S