


АМС(М)3000М

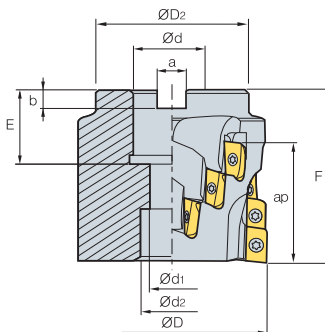

AA
90°
• AR : 9°
• RR : -9°~5°

Обозначение		ØD	ØD ₂	Ød	Ød ₁	Ød ₂	Ød ₃	a	b	E	F	Количество зубьев	ap		
АМС(М) 3063М		16	63	57	25.4(27)	14	20	28	9.5(12.4)	6(7)	38(38)	85	4	57	1.1
3080М		20	80	67	31.75(32)	14	26	40	12.7(14.4)	8(8)	40(40)	100	4	71	2.23
3100М		30	100	87	38.1(40)	22	32	60	15.9(16.4)	10(9)	40(40)	100	6	71	3.59

• () Метрическая система

Применяемые СМП

APMT-MM

APMT-MF




Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.		
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A	ST20
APMT 1604PDSR-MM	•	•	•	•	•	•	•	•										E05
1604PDSR-MF	•	•	•	•	•	•	•											
160410PDSR-MM	•	•	•	•	•	•	•											
160416PDSR-MM	•	•	•	•	•	•	•											
160424R-MM			•	•	•	•	•											
160430R-MM																		
160432R-MM	•	•	•	•	•	•	•											

Применяемые оправки

Обозначение	Ød	Оправка с хвостовиком ВТ	
АМС(М) 3063М	25.4	ВТ□□-FMA25.4-□□	ВТ□□-SMA25.4-□□
	27	ВТ□□-FMC27-□□	ВТ□□-SMC27-□□
3080М	31.75	ВТ□□-FMA31.75-□□	ВТ□□-SMA31.75-□□
	32	ВТ□□-FMC32-□□	ВТ□□-SMC32-□□
3100М	38.1	ВТ□□-FMA38.1-□□	ВТ□□-SMA38.1-□□
	40	ВТ□□-FMC40-□□	ВТ□□-SMC40-□□

Рекомендации по выбору СМП

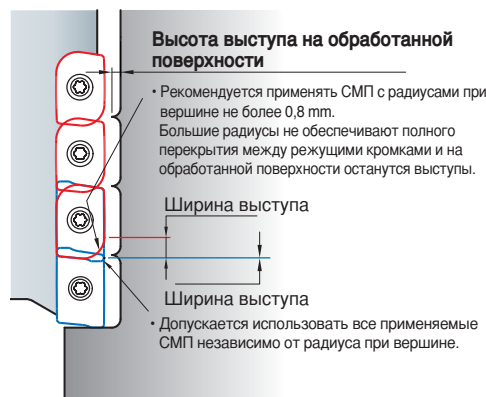

Комплектующие



FTKA0410

TW15S

