


# АМС(М)4000М

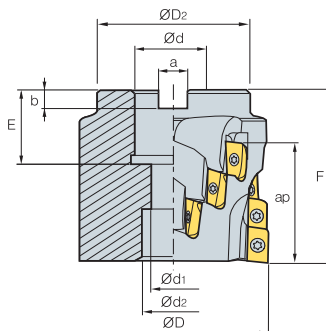

Обозначение		ØD	ØD2	Ød	Ød1	Ød2	Ød3	a	b	E	F	Количество зубьев	ap	
<b>АМС(М) 4063М</b>	16	63	57	25.4(27)	14	20	28	9.5(12.4)	6(7)	38(38)	85	4	61.1	1.1
<b>4080М</b>	20	80	67	31.75(32)	14	26	40	12.7(14.4)	8(8)	40(40)	100	4	76.1	2.23
<b>4100М</b>	30	100	87	38.1(40)	22	32	60	15.9(16.4)	10(9)	40(40)	100	6	76.1	3.59
<b>4125М</b>	18	125	87	38.1(40)	22	32	52	15.9(16.4)	10(9)	36(29)	68	6	46.1	4.0

( ) Метрическая система

## Применяемые СМП

АРМТ-ММ

АРМТ-МФ




Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.		
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A	ST20
АРМТ 1806PDSR-MM	●		●	●	●	●		●										E05
1806PDSR-MF			●	●	●	●												
1806PDSR-ML			●	●	●	●												
180612PDSR-MM	●		●	●	●	●												
180616PDSR-MM			●			●												
180620PDSR-MM			●															
180624PDSR-MM			●	●														
180630R-MM			●	●														
180632R-MM			●	●		●												


## Применяемые оправки

Обозначение	Ød	Оправка с хвостовиком ВТ			
АМС(М) 4063М	25.4	BT □□-FMA25.4-□□	BT □□-SMA25.4-□□		
	27	BT □□-FMC27-□□	BT □□-SMC27-□□		
4080М	31.75	BT □□-FMA31.75-□□	BT □□-SMA31.75-□□		
	32	BT □□-FMC32-□□	BT □□-SMC32-□□		
4100М	38.1	BT □□-FMA38.1-□□	BT □□-SMA38.1-□□		
	40	BT □□-FMC40-□□	BT □□-SMC40-□□		
4125М	38.1	BT □□-FMA38.1-□□	BT □□-SMA38.1-□□		
	40	BT □□-FMC40-□□	BT □□-SMC40-□□		

## Рекомендации по выбору СМП

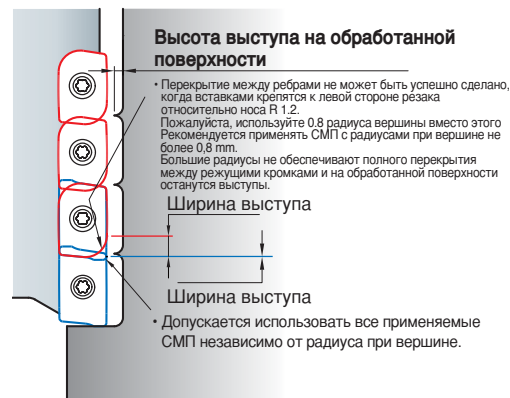

## Комплектующие



FTKA0410 TW15S