


AMS3000S

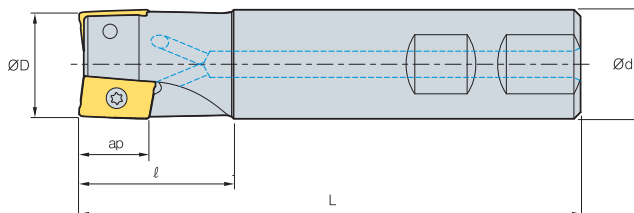

AA 90°
 • AR : 3°~14°
 • RR : -18°~-10°

(мм)

Обозначение		ØD	ød	ℓ	L	ap	
AMS	3025HS	2	25	25	35	115	0.40
	3025HS-2M25	2	25	25	35	180	0.65
	3025HS-2L25	2	25	25	60	220	0.75
	3032HS	3	32	32	40	125	0.69
	3032HS-2M32	2	32	32	40	200	1.13
	3032HS-2L32	2	32	32	65	260	1.52
	3032HS-3M32	3	32	32	40	200	1.12
	3032HS-3L32	3	32	32	65	260	1.48
	3040HS	4	40	32	42	130	0.80
	3040HS-3M32	3	40	32	42	200	1.24
	3040HS-3L32	3	40	32	42	260	1.61
	3040HS-4M32	4	40	32	42	200	1.21
	3040HS-4L32	4	40	32	42	260	1.58
	3040HS-S40	4	40	40	42	130	1.10
	3040HS-S42	4	40	42	42	130	1.20
	3050HS	5	50	32	45	135	1.00
	3050HS-S40	5	50	40	45	135	1.30
	3050HS-S42	5	50	42	45	135	1.40
3063HS	6	63	32	45	135	1.25	
3063HS-S40	6	63	40	45	135	1.50	
3063HS-S42	6	63	42	45	135	1.54	

Применяемые СМП


APMT-MF

APMT-MM



Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.	
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A
APMT 1604PDSR-MM	●		●	●	●	●	●	●									
1604PDSR-MF	●		●	●	●	●											
160410PDSR-MM	●		●	●	●	●											
160416PDSR-MM	●		●	●	●	●											
160424R-MM			●	●	●	●											
160430R-MM			●	●	●	●											
160432R-MM	●		●	●	●	●											

Комплектующие



ФТКА0408
ФТКА0410



TW15S



Ø25
Ø32~Ø100

Применяемые СМП смотреть на стр. E05

korloy@korloy-tools.ru
www.korloy-tools.ru

● : Наличие на складе

