


AMS3000S-K

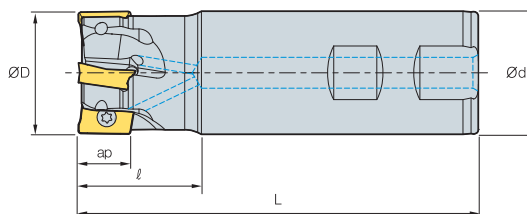

Обозначение			ØD	Ød	ℓ	L	ap	
AMS	3025HS-K	2	25	25	35	115	16	0.4
	3032HS-K	3	32	32	40	125	16	0.69
	3040HS-K	4	40	32	42	130	16	0.8
	3040HS-K-S40	4	40	40	42	130	16	1.1
	3040HS-K-S42	4	40	42	42	130	16	1.2
	3050HS-K	5	50	32	45	135	16	1.0
	3050HS-K-S40	5	50	40	45	135	16	1.3
	3050HS-K-S42	5	50	42	45	135	16	1.4
	3063HS-K	6	63	32	45	135	16	1.25
	3063HS-K-S40	6	63	40	45	135	16	1.5
3063HS-K-S42	6	63	42	45	135	16	1.54	

Применяемые СМП

АРКТ	АРКТ-MF	АРКТ-MM	АРКТ-MM1	АРКТ-MA	АРКТ-MA2	АРКТ-MA3	АРКТ-X22	АРКТ-X23	АРКТ-X24										
Обозначение	Тв. сплав с покрытием									Стр.									
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	Кермет	Тв. сплав							
											CN2000	CN20	CN30	H01	G10	ST30A	ST20		
APFT 1604PDSR-X22				●															
1604PDTR-X22																			
1604PDR-X28																			
1604PDSR-X28																			
1604PDTR-X28																			
АРКТ 1604PDSR	●			●				●											
1604PDSR-MF	●				●														
1604PDSR-MM	●	●		●	●	●	●	●											
160432R-MM1	●																		
1604PDFR-MA									●					●					
1604PDFR-MA2																			
160416FR-MA2																			
160432FR-MA2																			
1604PDFR-MA3														●	●				
1604PDSR-X22	●																		
1604PDTR-X22																			
1604PDR-X23																			
1604PDTR-X23																			
1604PDR-X24																			
1604PDTR-X24																			

Комплектующие



FTKA0408	TW15S	Ø25
FTKA0410		Ø32-Ø100

Применяемые СМП смотреть на стр. E04, E05

● : Наличие на складе