


AMS1000SE/2000SE

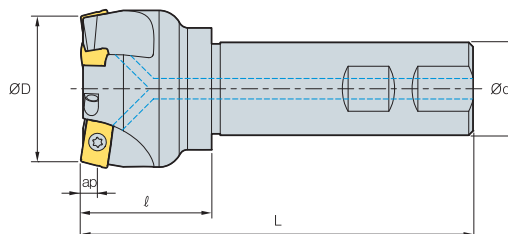

• AR : -4.5°~-1°
• RR : -3°~0°

Обозначение			ØD	ød	l	L	ap	
AMS	1025HSE	3	25	25	30	115	2.5	0.41
AMS	2025HSE	2	25	25	30	115	4	0.4
	2032HSE	3	32	32	40	125	4	0.72
	2040HSE	3	40	32	40	130	4	0.86
	2040HSE-S40	3	40	40	40	130	4	1.2
	2040HSE-S42	3	40	42	40	130	4	1.3
	2050HSE	4	50	32	40	135	4	0.98
	2050HSE-S40	4	50	40	40	135	4	1.3
	2050HSE-S42	4	50	42	40	135	4	1.4
	2063HSE	5	63	32	40	135	4	1.24
	2063HSE-S40	5	63	40	40	135	4	1.57
	2063HSE-S42	5	63	42	40	135	4	1.62

Применяемые СМП


APMT-MF

APMT-MM



Тип	Обозначение	Тв. сплав с покрытием										Кермет			Тв. сплав				Стр.
		NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10	ST30A	ST20	
1000 Тип	APMT 060202PDSR-MM			●	●	●	●												
	0602PDSR-MM			●	●	●	●	●											
	060208PDSR-MM			●	●	●	●												
	060212R-MM			●	●	●													
	060216R-MM			●															
2000 Тип	APMT 11T3PDSR-MM	●		●	●	●	●	●											
	11T3PDSR-MF	●		●	●	●	●												
	11T308PDSR-MM	●		●	●	●	●												
	11T312PDSR-MM	●		●	●	●	●												
	11T316R-MM	●		●	●	●	●												
	11T318R-MM			●	●	●	●												
	11T324R-MM			●	●	●	●												
	APXT 11T3PDSR-MR														●				
	11T308PDR-MR																		
	11T3PDR-MA																		
11T318R-MA																			

Комплектующие



1000 Тип	FTKA01842	-	TW06S-A
2000 Тип	FTKA02565S	TW08S	-

Применяемые СМП смотреть на стр. E05

korloy@korloy-tools.ru
www.korloy-tools.ru

● : Наличие на складе

