


# AMS1000M/1500M

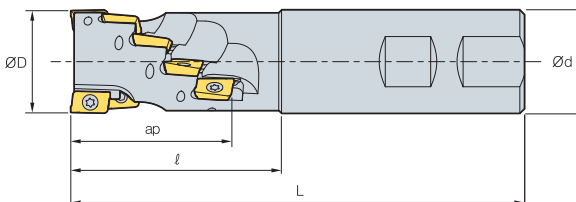

**AA**  
**90°**  
• AR : 7°~9°  
• RR : -13°~-10°

Обозначение			ØD	ød	l	L	Количество зубьев	ap	
AMS	<b>1016M</b>	6	16	16	30	80	2	15.5	0.3
	<b>1020M</b>	12	20	20	32	85	3	20.5	0.3
	<b>1025M</b>	20	25	25	39	95	4	25.5	0.3
AMS	<b>15020M</b>	3	20	20	42	105	1	26.5	0.3
	<b>15025M</b>	8	25	25	50	110	2	35	0.3
	<b>15032M</b>	10	32	32	60	120	2	44	0.3


## Применяемые СМП

### APMT-MM




Тип	Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.	
		NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A
1000 Тип	APMT 060202PDSR-MM			●	●	●	●	●										
	0602PDSR-MM			●	●	●	●	●										
	060208PDSR-MM			●	●	●	●	●										
	060212R-MM			●	●	●												
	060216R-MM				●													
1500 Тип	APMT 0903PDSR-MM			●	●	●	●											
	090308PDSR-MM			●	●	●	●											
	090312R-MM				●	●	●											
	090316R-MM				●	●												
	090320R-MM				●	●												

## Рекомендации по выбору СМП

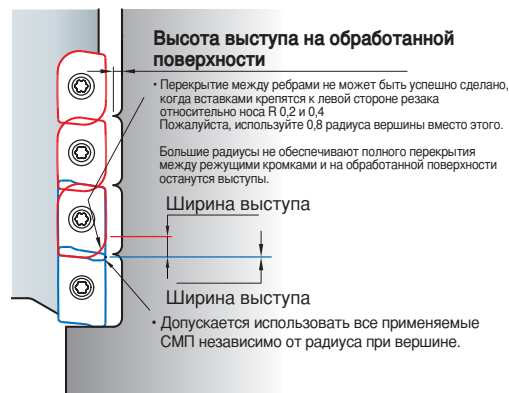

## Комплектующие



1000 Тип	FTKA01842	-	TW06S-A
1500 Тип	FTKA02565S	TW08S	-

