


# Е Концевые сборные фрезы с хвостовиком ВТ

## BT50 AM3000HS / AM4000HS

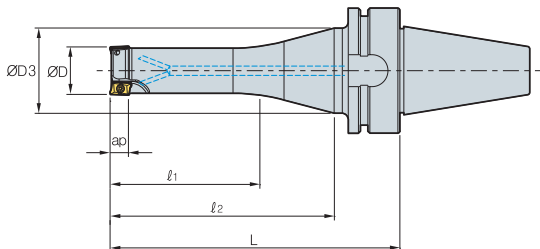

Обозначение			$\varnothing D$	$\varnothing D_3$	$\ell_1$	$\ell_2$	L	$a_p$
BT50	AM3025HS-2	2	25	43	65	113	158	16
	AM3025HS-2L	2	25	43	55	123	168	16
	AM3032HS-3	3	32	43	70	113	158	16
	AM3032HS-3L	3	32	43	60	123	168	16
	AM3040HS-4	4	40	47	50	98	143	16
	AM3040HS-4L	4	40	47	40	108	153	16
	AM3050HS-5	5	50	47	50	98	143	16
	AM3050HS-5L	5	50	47	40	108	153	16
BT50	AM4020HS-1	1	20	43	50	98	143	17
	AM4025HS-2	2	25	43	65	113	158	17
	AM4032HS-3	3	32	43	70	113	158	17
	AM4032HS-3L	3	32	43	60	123	168	17
	AM4040HS-4	4	40	47	50	98	143	17
	AM4040HS-4L	4	40	47	40	108	153	17
	AM4050HS-5	5	50	47	50	98	143	17
	AM4050HS-5L	5	50	47	40	108	153	17

### Применяемые СМП


APMT-MM

APMT-MF



Тип	Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.	
		NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A
3000 Тип	APMT 1604PDSR-MM	●	●	●	●	●	●	●	●									
	1604PDSR-MF	●	●	●	●	●	●	●	●									
	160410PDSR-MM	●	●	●	●	●	●	●	●									
	160416PDSR-MM	●	●	●	●	●	●	●	●									
	160424R-MM			●	●	●	●	●	●									
	160430R-MM			●	●	●	●	●	●									
	160432R-MM	●	●	●	●	●	●	●	●									
4000 Тип	APMT 1806PDSR-MM	●	●	●	●	●	●	●	●									
	1806PDSR-MF	●	●	●	●	●	●	●	●									
	1806PDSR-ML	●	●	●	●	●	●	●	●									
	180612PDSR-MM	●	●	●	●	●	●	●	●									
	180616PDSR-MM	●	●	●	●	●	●	●	●									
	180620PDSR-MM			●	●	●	●	●	●									
	180624PDSR-MM			●	●	●	●	●	●									
	180630R-MM			●	●	●	●	●	●									
	180632R-MM			●	●	●	●	●	●									

### Комплектующие



3000 Тип	FTKA0408 FTKA0410	TW15S	$\varnothing 25$ $\varnothing 32 \sim \varnothing 100$
4000 Тип	FTKA0408 FTKA0410	TW15S	$\varnothing 20 \sim \varnothing 25$ $\varnothing 32 \sim \varnothing 200$

Применяемые СМП смотреть на стр. E05

● : Наличие на складе