

FMRS3000

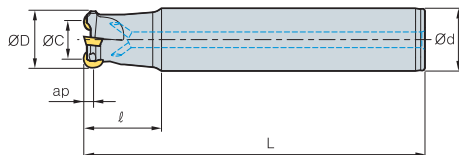


Рис. 1

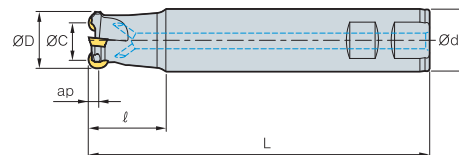


Рис. 2



• AR : 5°
• RR : -8°~5°


(мм)

| Обозначение | | ØD | ØC | ød | ℓ | L | ap | | Рис. |
|-----------------------|---|----|----|----|-----|-----|----|------|------|
| FMRS 3021HRD-M | 1 | 21 | 11 | 20 | 40 | 150 | 5 | 0.4 | 1 |
| 3021HRD-M2 | 2 | 21 | 11 | 20 | 40 | 150 | 5 | 0.4 | 1 |
| 3021HRD-L | 1 | 21 | 11 | 20 | 50 | 200 | 5 | 0.6 | 1 |
| 3021HRD-L2 | 2 | 21 | 11 | 20 | 50 | 200 | 5 | 0.6 | 1 |
| 3025HRD-S | 2 | 25 | 15 | 25 | 35 | 115 | 5 | 0.5 | 2 |
| 3025HRD-M | 2 | 25 | 15 | 25 | 70 | 200 | 5 | 0.7 | 1 |
| 3025HRD-L | 2 | 25 | 15 | 25 | 100 | 250 | 5 | 1 | 1 |
| 3026HRD-M | 2 | 26 | 16 | 25 | 70 | 200 | 5 | 0.65 | 1 |
| 3026HRD-L | 2 | 26 | 16 | 25 | 100 | 250 | 5 | 0.7 | 1 |
| 3032HRD-S | 3 | 32 | 22 | 32 | 40 | 125 | 5 | 1 | 2 |
| 3032HRD-M | 3 | 32 | 22 | 32 | 70 | 200 | 5 | 1.3 | 1 |
| 3032HRD-L | 3 | 32 | 22 | 32 | 150 | 300 | 5 | 1.6 | 1 |
| 3040HRD-S | 4 | 40 | 30 | 32 | 40 | 125 | 5 | 1.3 | 2 |
| 3040HRD-M | 4 | 40 | 30 | 32 | 70 | 200 | 5 | 1.5 | 1 |
| 3040HRD-L | 4 | 40 | 30 | 32 | 150 | 300 | 5 | 1.8 | 1 |

Применяемые СМП

| Обозначение | RDKT-MF | | | RDKT-MM | | | | | | RDCT-MA | | | Стр. | | | | | |
|----------------|---------|--------|--------|---------|--------|--------|--------|--------|--------|---------|--------|------|------|------|-----|-----|-------|------------|
| | NCM325 | NCM335 | NC5330 | PC3500 | PC5300 | PC3545 | PC9530 | PC6510 | PC215K | PD2000 | CN2000 | CN20 | | CN30 | H01 | G10 | ST30A | ST20 |
| RDCT 10T3M0-MA | | | | | ● | ● | ● | | | | | | | ● | | | | E11 E12 |
| RDKT 10T3M0-MF | | | | | ● | ● | ● | | | | | | | | | | | |
| 10T3M0-MM | ● | ● | | ● | ● | ● | ● | ● | | | | | | | | | | |

Комплектующие



FTGA03508(07)



TW15S

