



# I Патроны для зажима хвостовиков с конусом Морзе

## BT-MTA

MAS403-BT

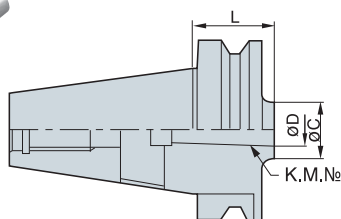

Исп. №1

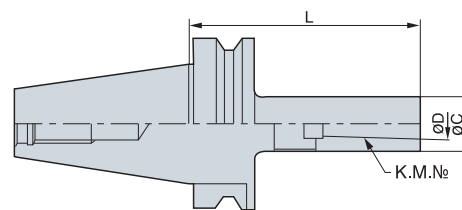

Исп. №2

(мм)

| Обозначение             | К.М.<br>№ | L   | ØD     | ØC | kg  | Исполнение<br>№ |
|-------------------------|-----------|-----|--------|----|-----|-----------------|
| <b>BT30 - MTA1 - 45</b> | 1         | 45  | 12.065 | 25 | 0.6 | 1               |
| <b>MTA2 - 60</b>        | 2         | 60  | 17.780 | 32 | 0.6 | 1               |
| <b>MTA3 - 80</b>        | 3         | 80  | 23.825 | 40 | 0.6 | 1               |
| <b>BT40 - MTA1 - 45</b> | 1         | 45  | 12.065 | 25 | 1.1 | 1               |
| <b>120</b>              | 1         | 120 | 12.065 | 25 | 1.2 | 2               |
| <b>MTA2 - 60</b>        | 2         | 60  | 17.780 | 32 | 1.1 | 1               |
| <b>120</b>              | 2         | 120 | 17.780 | 32 | 1.6 | 2               |
| <b>MTA3 - 75</b>        | 3         | 75  | 23.825 | 40 | 1.2 | 1               |
| <b>135</b>              | 3         | 135 | 23.825 | 40 | 1.7 | 2               |
| <b>MTA4 - 95</b>        | 4         | 95  | 31.267 | 50 | 1.3 | 1               |
| <b>165</b>              | 4         | 165 | 31.267 | 50 | 3.0 | 2               |
| <b>BT50 - MTA1 - 45</b> | 1         | 45  | 12.065 | 25 | 3.9 | 1               |
| <b>120</b>              | 1         | 120 | 12.065 | 25 | 4.2 | 2               |
| <b>180</b>              | 1         | 180 | 12.065 | 25 | 4.3 | 2               |
| <b>MTA2 - 45</b>        | 2         | 45  | 17.780 | 32 | 3.9 | 1               |
| <b>135</b>              | 2         | 135 | 17.780 | 32 | 4.3 | 2               |
| <b>180</b>              | 2         | 180 | 17.780 | 32 | 4.6 | 2               |
| <b>MTA3 - 45</b>        | 3         | 45  | 23.825 | 40 | 3.8 | 1               |
| <b>150</b>              | 3         | 150 | 23.825 | 40 | 4.6 | 2               |
| <b>180</b>              | 3         | 180 | 23.825 | 40 | 4.9 | 2               |
| <b>MTA4 - 75</b>        | 4         | 75  | 31.267 | 50 | 3.9 | 1               |
| <b>180</b>              | 4         | 180 | 31.267 | 50 | 5.4 | 2               |
| <b>MTA5- 105</b>        | 5         | 105 | 44.399 | 65 | 4.5 | 1               |
| <b>210</b>              | 5         | 210 | 44.399 | 65 | 7.2 | 2               |

• Патроны с К.М. предназначены для закрепления сверл, концевых фрез, разверток и т.д.

