

# FMRS5000

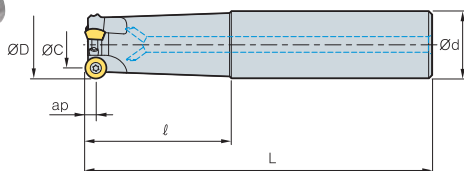


Рис. 1

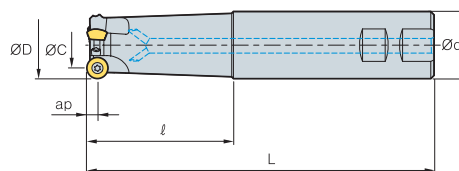


Рис. 2



- AR : 5°
- RR : 8°~5°

(мм)

Обозначение		ØD	ØC	ød	ℓ	L	ap		Рис.
<b>FMRS 5040HRD-S</b>	2	40	24	32	40	125	8	1.4	2
<b>5040HRD-M</b>	2	40	24	32	70	200	8	1.8	1
<b>5040HRD-L</b>	2	40	24	32	150	300	8	2.0	1
<b>5040HRD-S40</b>	2	40	24	40	40	125	8	1.6	2
<b>5040HRD-M40</b>	2	40	24	40	70	200	8	2.0	1
<b>5040HRD-L40</b>	2	40	24	40	150	300	8	2.4	1
<b>5040HRD-S42</b>	2	40	24	42	40	125	8	2.0	2
<b>5040HRD-M42</b>	2	40	24	42	70	200	8	2.4	1
<b>5040HRD-L42</b>	2	40	24	42	150	300	8	2.8	1
<b>5050HRD-S40</b>	3	50	34	40	50	150	8	2.0	2
<b>5050HRD-M40</b>	3	50	34	40	50	250	8	2.4	1
<b>5050HRD-L40</b>	3	50	34	40	50	300	8	2.6	1
<b>5050HRD-S</b>	3	50	34	42	50	150	8	1.5	2
<b>5050HRD-M</b>	3	50	34	42	50	250	8	1.8	1
<b>5050HRD-L</b>	3	50	34	42	50	300	8	2.0	1
<b>5063HRD-S40</b>	4	63	47	40	50	150	8	1.7	2
<b>5063HRD-M40</b>	4	63	47	40	50	250	8	2.0	1
<b>5063HRD-L40</b>	4	63	47	40	50	300	8	2.3	1
<b>5063HRD-S</b>	4	63	47	42	50	150	8	1.6	2
<b>5063HRD-M</b>	4	63	47	42	50	250	8	1.8	1
<b>5063HRD-L</b>	4	63	47	42	50	300	8	2.0	1

## Применяемые СМП

RDHW-E,F,S

RDKT-MM



Обозначение	Тв. сплав с покрытием									Кермет			Тв. сплав				Стр.	
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10	ST30A		ST20
RDHW 1605M0E 1605M0F 1605M0S																		E13
RDKT 1605M0-MM 1605M0-ML				●		●												

## Комплектующие

Винт кассеты

Ключ



FTGA0513-P

TW20-100