


AMS3000SE

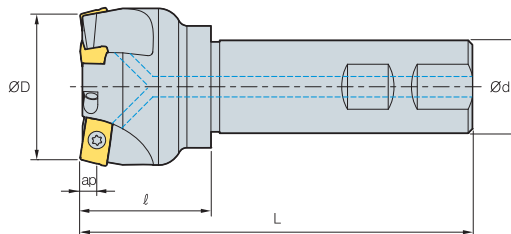

• AR : -4.5°~-1°
• RR : -3°~0°

(MM)

Обозначение		$\varnothing D$	$\varnothing d$	l	L	ap	
AMS 3050HSE	3	50	32	45	135	6	1.0
3050HSE-S40	3	50	40	45	135	6	1.3
3050HSE-S42	3	50	42	45	135	6	1.4
3063HSE	4	63	32	45	135	6	1.3
3063HSE-S40	4	63	40	45	135	6	1.6
3063HSE-S42	4	63	42	45	135	6	1.7

Применяемые СМП

APMT-MF

APMT-MM



Обозначение	Тв. сплав с покрытием									Кермет			Тв. сплав				Стр.
	NCM825	NCM835	NC5330	PC3500	PC5300	PC3545	PC9630	PC6510	PC215K	PD2000	CN2000	CN20	CN30	HD1	G10	ST30A	
APMT 1604PDSR-MM	●		●	●	●	●	●	●									
1604PDSR-MF	●		●	●	●	●											
160410PDSR-MM	●		●	●	●	●											
160416PDSR-MM	●		●	●	●	●											
160424R-MM			●	●	●	●											
160430R-MM			●	●	●	●											
160432R-MM	●		●	●	●	●											



Комплектующие

Винт кассеты



Ключ



ФТКА0410

TW15S