


# FMAS4000

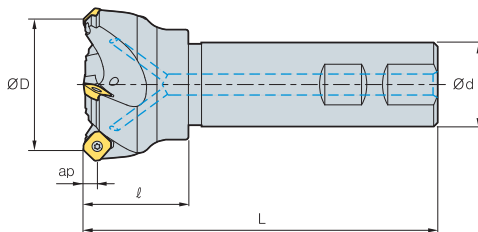

• AR : 23°  
• RR : -17°~13°

(MM)

Обозначение		ØD	Ød	l	L	αp	
<b>FMAS</b> 4050HR	3	50	32	45	135	6.5	1.5
4050HR-S40	3	50	40	45	135	6.5	2.1
4050HR-S42	3	50	42	45	135	6.5	2.7
4063HR	4	63	32	45	135	6.5	2
4063HR-S40	4	63	40	45	135	6.5	2.6
4063HR-S42	4	63	42	45	135	6.5	3.2

• ( ) Метрическая система

## Применяемые СМП

SEET-MF	SEET-MM	SEET-MA	SEXT-MF	SEXT-MM	SEXT-MR	SEEW	SEEW-W											
Обозначение	Тв. сплав с покрытием									Кермет			Тв. сплав				Стр.	
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10	ST30A		ST20
SEET 14M4AGFN-MA																		
14M4AGSN-MF	●	●			●			●	●					●				
14M4AGSN-MM	●	●			●			●	●									
SEXT 14M4AGSN-MF	●				●			●	●									
14M4AGSN-MM	●				●			●	●									
14M4AGSN-MR	●				●	●		●	●									
SEEW 14M4AGTN													●					
14M4AGFN-W																		
14M4AGSN-W																		
14M4AGTN-W				●				●										

## Комплектующие



FTGA03512



SS42SAF



SHXN0509F



TW15S



HW35L

Применяемые СМП смотреть на стр. E14, E15

korloy@korloy-tools.ru  
www.korloy-tools.ru

● : Наличие на складе

