


FMPS4000

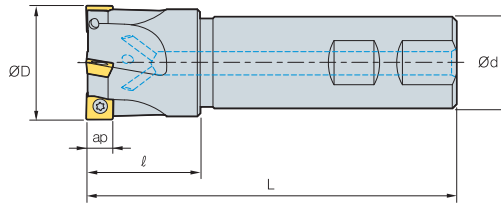

• AR : 10°
• RR : -9°~8°

(MM)

Обозначение		øD	ød	l	L	ap	
FMPS 4040HS	3	40	32	40	130	11	1
4040HS-S40	3	40	40	40	140	11	1.3
4040HS-S42	3	40	42	40	140	11	1.4
4050HS	4	50	32	45	135	11	1.5
4050HS-S40	4	50	40	45	145	11	1.7
4050HS-S42	4	50	42	45	145	11	1.6
4063HS	5	63	32	45	135	11	2.1
4063HS-S40	5	63	40	45	145	11	2.4
4063HS-S42	5	63	42	45	145	11	2.6

Применяемые СМП

	SDET-MF	SDET-MM	SDET-MA	SDXT-MF	SDXT-MM	SDXT-MA												
Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.		
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10		ST30A	ST20
SDET 130504R-MA										●				●				
130508R-MF																		
130508R-MM																		
SDXT 130508R-MF	●	●			●			●										
130508R-MM	●	●		●	●	●	●	●										
130538-MM																		
130508R-MA														●				

Комплектующие



FTNC04511



TW20S

Схема сборки

