


# HRMDS09

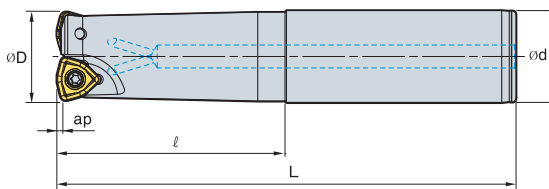

Обозначение			$\varnothing D$	$\varnothing d$	$\ell$	L	ap	
<b>HRMDS</b>	<b>0940HR-4M40</b>	4	40	40	130	250	1.5	2.2
	<b>0940HR-4L40</b>	4	40	40	180	300	1.5	2.7
	<b>0940HR-4S42</b>	4	40	42	60	150	1.5	1.4
	<b>0940HR-4M42</b>	4	40	42	130	250	1.5	2.3
	<b>0940HR-4L42</b>	4	40	42	180	300	1.5	2.8
	<b>0950HR-4S32</b>	4	50	32	40	150	1.5	1.1
	<b>0950HR-4M32</b>	4	50	32	40	250	1.5	1.6
	<b>0950HR-4L32</b>	4	50	32	40	300	1.5	2
	<b>0950HR-4S40</b>	4	50	40	40	150	1.5	1.4
	<b>0950HR-4M40</b>	4	50	40	40	250	1.5	2.4
	<b>0950HR-4L40</b>	4	50	40	40	300	1.5	2.9
	<b>0950HR-4S42</b>	4	50	42	40	150	1.5	1.6
	<b>0950HR-4M42</b>	4	50	42	40	250	1.5	2.6
	<b>0950HR-4L42</b>	4	50	42	40	300	1.5	3.1
	<b>0950HR-5S32</b>	5	50	32	40	150	1.5	1.1
	<b>0950HR-5M32</b>	5	50	32	40	250	1.5	1.6
	<b>0950HR-5L32</b>	5	50	32	40	300	1.5	2
	<b>0950HR-5S40</b>	5	50	40	40	150	1.5	1.4
	<b>0950HR-5M40</b>	5	50	40	40	250	1.5	2.4
	<b>0950HR-5L40</b>	5	50	40	40	300	1.5	2.9
<b>0950HR-5S42</b>	5	50	42	40	150	1.5	1.6	
<b>0950HR-5M42</b>	5	50	42	40	250	1.5	2.6	
<b>0950HR-5L42</b>	5	50	42	40	300	1.5	3.1	

## Применяемые СМП

WNMX-MM



Обозначение	Тв. сплав с покрытием							Кермет			Тв. сплав				Стр.			
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01		G10	ST30A	ST20
WNMX 09T316ZNN-MM				●	●	●	●											E21

## Комплектующие



FTKA0307

TW09S

