



Фрезы для обработки Т-образных пазов

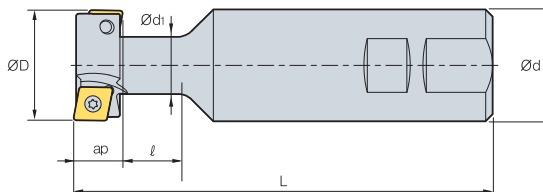

TFE

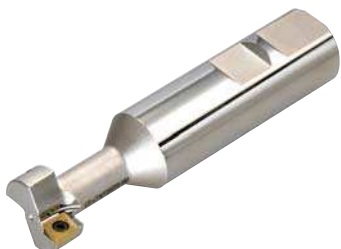

AA
90°
• AR : 5°
• RR : -5°



(мм)

Обозначение		ØD	Ød	Ød ₁	l	L	ap	Применяемые СМП
TFE								
2125R/L	2	21	25	10.5	20	109	9	CPMT06
2525R/L	2	25	25	12.5	21	112	11	CPMT08
3232R/L	2	32	32	16.5	26	120	14	CPMT09
4032R/L	2	40	32	20.5	32	130	18	CPMH12
5032R/L	4	50	32	26.5	38	140	22	CPMH12

Применяемые СМП

CPMT

CPMH



Обозначение	Тв. сплав с покрытием										Кермет			Тв. сплав			Стр.
	NCM325	NCM335	NC5330	PC3500	PC5300	PC3545	PC9530	PC6510	PC215K	PD2000	CN2000	CN20	CN30	H01	G10	ST30A	
CPMT 060204-ММ				●													
080308-ММ				●													
09Т308-ММ				●													
CPMH 120408-ММ				●													

Фрезы для обработки Т-образных пазов



Комплектующие




Винт



Ключ

2125R/L	FTNA02555	TW08S
2525R/L	FTNA0306	TW09S
3232R/L	FTNA0407	TW15S
4032R/L	PTMA0511A	TW15S
5032R/L		

Схема сборки

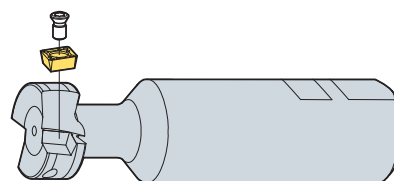

Применяемые СМП смотреть на стр.Е07