


TPDB-5D *New*

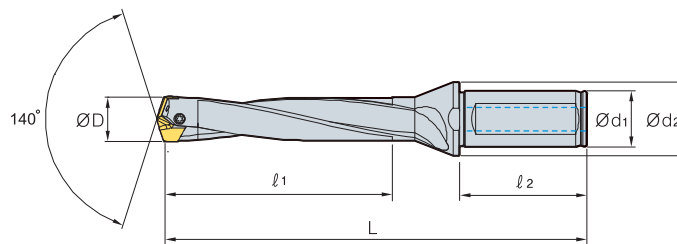

(mm)

Обозначение	ØD	Ød1	Ød2	l1	l2	L	СМП
TPDB 100-16-5	10.0 - 10.4	16	20	50.0	48	115	TPD100B - 104B
105-16-5	10.5 - 10.9	16	20	52.5	48	117	TPD105B - 109B
110-16-5	11.0 - 11.4	16	20	55.0	48	120	TPD110B - 114B
115-16-5	11.5 - 11.9	16	20	57.5	48	123	TPD115B - 119B
120-16-5	12.0 - 12.4	16	20	60.0	48	126	TPD120B - 124B
125-16-5	12.5 - 12.9	16	20	62.5	48	129	TPD125B - 129B
130-16-5	13.0 - 13.4	16	20	65.0	48	133	TPD130B - 134B
135-16-5	13.5 - 13.9	16	20	67.5	48	136	TPD135B - 139B
140-16-5	14.0 - 14.4	16	20	70.0	48	139	TPD140B - 144B
145-16-5	14.5 - 14.9	16	20	72.5	48	143	TPD145B - 149B
150-20-5	15.0 - 15.4	20	25	75.0	50	148	TPD150B - 154B
155-20-5	15.5 - 15.9	20	25	77.5	50	151	TPD155B - 159B
160-20-5	16.0 - 16.4	20	25	80.0	50	154	TPD160B - 164B
165-20-5	16.5 - 16.9	20	25	82.5	50	157	TPD165B - 169B
170-20-5	17.0 - 17.4	20	25	85.0	50	161	TPD170B - 174B
175-20-5	17.5 - 17.9	20	25	87.5	50	164	TPD175B - 179B
180-25-5	18.0 - 18.4	25	33	90.0	56	173	TPD180B - 184B
185-25-5	18.5 - 18.9	25	33	92.5	56	176	TPD185B - 189B
190-25-5	19.0 - 19.4	25	33	95.0	56	180	TPD190B - 194B
195-25-5	19.5 - 19.9	25	33	97.5	56	183	TPD195B - 199B
200-25-5	20.0 - 20.4	25	33	100.0	56	186	TPD200B - 204B
205-25-5	20.5 - 20.9	25	33	102.5	56	189	TPD205B - 209B
210-25-5	21.0 - 21.4	25	33	105.0	60	193	TPD210B - 214B
215-25-5	21.5 - 21.9	25	33	107.5	60	196	TPD215B - 219B
220-25-5	22.0 - 22.4	25	33	110.0	60	199	TPD220B - 224B
225-25-5	22.5 - 22.9	25	33	112.5	60	202	TPD225B - 229B
230-25-5	23.0 - 23.4	25	33	115.0	60	206	TPD230B - 234B
235-25-5	23.5 - 23.9	25	33	117.5	60	209	TPD235B - 239B
240-32-5	24.0 - 24.4	32	43	120.0	60	216	TPD240B - 244B
245-32-5	24.5 - 24.9	32	43	122.5	60	219	TPD245B - 249B
250-32-5	25.0 - 25.4	32	43	125.0	60	223	TPD250B - 254B
255-32-5	25.5 - 25.9	32	43	127.5	60	226	TPD255B - 259B
260-32-5	26.0 - 26.9	32	43	130.0	60	229	TPD260B - 269B
270-32-5	27.0 - 27.9	32	43	135.0	60	236	TPD270B - 279B
280-32-5	28.0 - 28.9	32	43	140.0	60	242	TPD280B - 289B
290-32-5	29.0 - 29.9	32	43	145.0	60	249	TPD290B - 299B

Применяемые СМП смотреть на стр. G21

Сверла сборные

Сверление

G