

Развертки серии SCRS

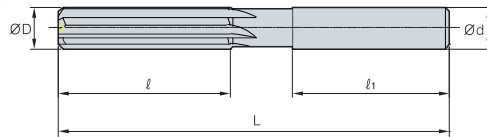


Рис.1

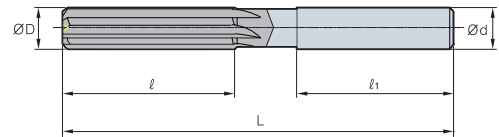


Рис.2

(мм)							
Обозначение	Число зубьев	ØD	Ød	ℓ	ℓ ₁	L	Рис.
SCRS	050S	5.0	6.0	20	40	100	1
	060S	6.0	6.0	20	40	115	1
	070S	7.0	8.0	20	40	125	1
	080S	8.0	8.0	20	40	135	1
	090S	9.0	10.0	20	45	140	1
	100B	10.0	10.0	25	50	145	2
	110B	11.0	12.0	25	50	150	2
	120B	12.0	12.0	25	50	160	2
	130B	13.0	16.0	25	50	165	2
	140B	14.0	16.0	25	50	170	2
	150B	15.0	16.0	30	50	180	2
	160B	16.0	16.0	30	50	190	2
	180B	18.0	20.0	30	55	210	2
	200B	20.0	20.0	40	60	230	2

Развертки серии SCRH

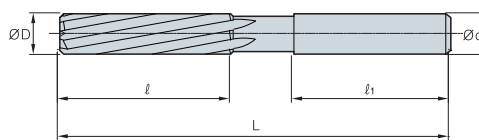


Рис. 1

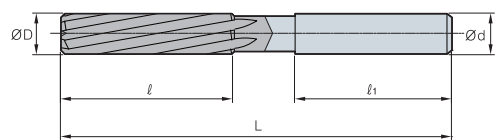


Рис. 2

(мм)							
Обозначение	Число зубьев	ØD	Ød	ℓ	ℓ ₁	L	Рис.
SCRH	050S	5.0	6.0	20	40	100	1
	060S	6.0	6.0	20	40	115	1
	070S	7.0	8.0	20	40	125	1
	080S	8.0	8.0	20	40	135	1
	090S	9.0	10.0	20	45	140	1
	100B	10.0	10.0	25	50	145	2
	110B	11.0	12.0	25	50	150	2
	120B	12.0	12.0	25	50	160	2
	130B	13.0	16.0	25	50	165	2
	140B	14.0	16.0	25	50	170	2
	150B	15.0	16.0	30	50	180	2
	160B	16.0	16.0	30	50	190	2
	180B	18.0	20.0	30	55	210	2
	200B	20.0	20.0	40	60	230	2