


AMS2000M/4000M

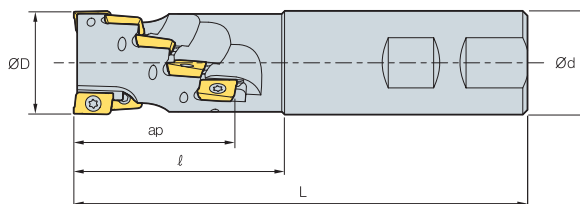

AA
90°
• AR : 7°~9°
• RR : -13°~-10°

(мм)

Обозначение		ØD	Ød	ℓ	L	Количество зубьев	ap	
AMS 2020M	3	20	20	45	120	1	29.4	0.32
	8	25	25	55	130	2	38.9	0.40
	10	32	32	65	140	2	48.5	0.65
	14	40	40	75	150	2	58	0.75
AMS 4032M	4	32	32	60	130	2	31.6	0.65
	6	40	40	70	140	2	46	1.11
	6	50	40	55	125	2	46	1.22
	8	50	40	70	140	2	61	1.37

Применяемые СМП

APMT-MF

APMT-MM




Тип	Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.	
		NCM325	NCM335	NC5330	PC3500	PC5300	PC5400	PC3545	PC9530	PC6510	PD2000	CN2000	CN20	CN30	H01	G10		ST30A
2000 Тип	APMT 11T3PDFR-MA																	
	11T3PDER-ML																	
	11T3PDSR-MM	●		●	●	●	●	●	●									
	11T3PDSR-MF	●		●	●	●	●	●	●									
	11T308PDSR-MM	●		●	●	●	●	●	●									
	11T312PDSR-MM	●		●	●	●	●	●	●									
	11T316R-MM	●		●	●	●												
	11T318R-MM																	
4000 Тип	APMT 1806PDFR-MA																	
	1806PDER-ML																	
	1806PDSR-MM	●		●	●	●	●	●	●									
	1806PDSR-MF	●		●	●	●	●	●	●									
	180612PDSR-MM	●		●	●	●	●	●	●									
	180616PDSR-MM			●														
	180620PDSR-MM				●	●												
	180624PDSR-MM				●	●												
	180630R-MM																	
	180632R-MM			●	●				●	●								

Рекомендации по выбору СМП



Комплектующие



2000 Тип	FTKA02565S	TW08S
4000 Тип	FTKA0410	TW15S

Применяемые СМП E05