


HSK63A AM3000HS / 4000HS

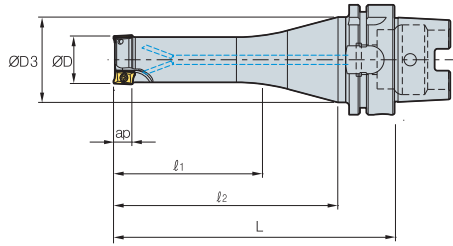

• AR : 7°~10°
• RR : -20°~7°

(мм)

Обозначение		$\varnothing D$	$\varnothing D_3$	l_1	l_2	L	a_p
HSK63A AM3025HS-2	2	25	43	65	113	146	16
AM3025HS-2L	2	25	43	55	123	156	16
AM3032HS-3	3	32	43	70	113	146	16
AM3032HS-3L	3	32	43	60	123	156	16
AM3040HS-4	4	40	47	50	98	131	16
AM3040HS-4L	4	40	47	40	108	141	16
AM3050HS-5	5	50	47	50	98	131	16
AM3050HS-5L	5	50	47	40	108	141	16
HSK63A AM4020HS-1	1	20	43	50	98	131	17
AM4025HS-2	2	25	43	65	113	146	17
AM4032HS-3	3	32	43	70	113	146	17
AM4032HS-3L	3	32	43	60	123	156	17
AM4040HS-4	4	40	47	50	98	131	17
AM4040HS-4L	4	40	47	40	108	141	17
AM4050HS-5	5	50	47	50	98	131	17
AM4050HS-5L	5	50	47	40	108	141	17

Применяемые СМП

APMT-MA

APMT-ML



APMT-MM

APMT-MF



Тип	Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.		
		NCM825	NCM835	NC5330	PC3500	PC5300	PC5400	PC3345	PC9530	PC6510	PD2000	CN2000	CN20	CN30	H01	G10		ST30A	ST20
3000 Тип	APMT 1604PDR-MA																		E05
	1604PDR-ML																		
	1604PDR-MM	•		•	•	•	•	•	•										
	1604PDR-MF	•		•	•	•	•	•	•										
	160410PDR-MM	•		•	•	•	•	•	•										
	160416PDR-MM	•		•	•	•	•	•	•										
	160424R-MM			•	•	•	•	•	•										
	160430R-MM			•	•	•	•	•	•										
4000 Тип	APMT 1806PDR-MA																	E05	
	1806PDR-ML																		
	1806PDR-MM	•		•	•	•	•	•	•										
	1806PDR-MF	•		•	•	•	•	•	•										
	1806PDR-ML			•	•	•	•	•	•										
	180612PDR-MM	•		•	•	•	•	•	•										
	180616PDR-MM			•	•	•	•	•	•										
	180620PDR-MM			•	•	•	•	•	•										
	180624PDR-MM			•	•	•	•	•	•										
	180630R-MM			•	•	•	•	•	•										
180632R-MM			•	•	•	•	•	•											

Комплектующие



3000 Тип	FTKA0408 FTKA0410	TW15S	$\varnothing 25$ $\varnothing 32 \sim \varnothing 100$
4000 Тип	FTKA0408 FTKA0410	TW15S	$\varnothing 20 \sim \varnothing 25$ $\varnothing 32 \sim \varnothing 200$