


FMAS3000

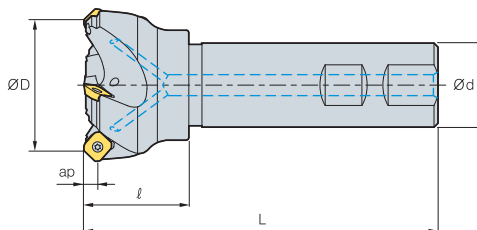

• AR : 23°
• RR : -17°~13°

(MM)

Обозначение		ØD	Ød	ℓ	L	ap	
FMAS	3025HR	2	25	25	35	115	0.4
	3032HR	3	32	25	40	125	0.5
	3032HR-S32	3	32	32	40	130	0.8
	3040HR	3	40	32	40	130	0.9
	3040HR-S40	3	40	40	40	140	1.3
	3040HR-S42	3	40	42	40	140	1.4
	3050HR	4	50	32	40	135	1
	3050HR-S40	4	50	40	40	140	1.3
	3050HR-S42	4	50	42	40	140	1.5
	3063HR	5	63	32	45	135	1.2
	3063HR-S40	5	63	40	45	145	1.6
	3063HR-S42	5	63	42	45	145	1.7

• () Метрическая система

Применяемые СМП

	SEET-MF	SEET-MM	SEET-MA	SEXT-MF	SEXT-MM	SEXT-MR	SEEW	SEEW-W									
Обозначение	Тв. сплав с покрытием									Стр.							
	NCM325	NCM335	NC5330	PC3500	PC5300	PC5345	PC9530	PC6510	PC215K		PD2000	Кермет			Тв. сплав		
SEET 0903AGFN-MA																	
SEET 0903AGSN-MF	●																
SEET 0903AGSN-MM	●				●												
SEXT 0903AGSN-MF					●	●											
SEXT 0903AGSN-MM				●	●	●		●	●								
SEXT 0903AGSN-MR																	
SEEW 0903AGTN													●				

Комплектующие



ФТКА0307



TW09S