


FMPS4000

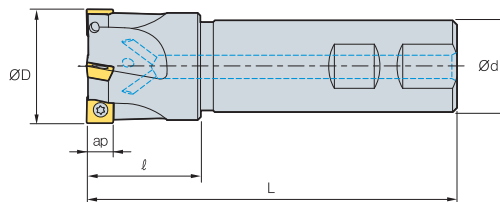

AA
90°
• AR : 10°
• RR : -9°~8°

(мм)

Обозначение		ØD	Ød	l	L	ap	
FMPS							
4040HS	3	40	32	40	130	11	1
4040HS-S40	3	40	40	40	140	11	1.3
4040HS-S42	3	40	42	40	140	11	1.4
4050HS	4	50	32	45	135	11	1.5
4050HS-S40	4	50	40	45	145	11	1.7
4050HS-S42	4	50	42	45	145	11	1.6
4063HS	5	63	32	45	135	11	2.1
4063HS-S40	5	63	40	45	145	11	2.4
4063HS-S42	5	63	42	45	145	11	2.6

Применяемые СМП

	SDET-MF	SDET-MM	SDET-MA	SDXT-MF	SDXT-MM	SDXT-MA													
Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.			
	NCM325	NCM335	NC5330	PC3500	PC3300	PC5400	PC3545	PC9530	PC6510	PD2000	CN2000	CN20	CN30	H01	G10	ST30A	ST20		
SDET 130504R-MA														●				E13	
130508R-MF																			E14
130508R-MM																			
SDXT 130508R-MF	●	●			●	●		●	●										
130508R-MM	●	●		●	●	●	●	●	●										
130538-MM																			
130508R-MA														●					

Комплектующие



FTNC04511



TW20S

Схема сборки

