


# HRMS 08/10

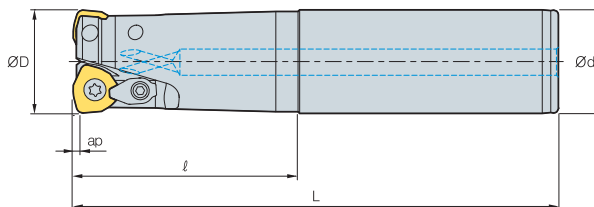

(мм)

Обозначение		øD	ød	l	L	ap		
<b>HRMS 0820HR-2S20</b>	2	20	20	50	130	1.0	0.3	
	2	20	20	100	180	1.0	0.4	
	2	20	20	130	250	1.0	0.5	
	<b>0821HR-2S20</b>	2	21	20	50	130	1.0	0.3
		2	21	20	50	180	1.0	0.4
		2	21	20	50	250	1.0	0.5
<b>HRMS 1025HR-2S25</b>	2	25	25	60	140	1.5	0.4	
	2	25	25	120	200	1.5	0.6	
	2	25	25	180	300	1.5	0.9	
	<b>1026HR-2S25</b>	2	26	25	60	140	1.5	0.4
		2	26	25	60	200	1.5	0.6
		2	26	25	60	300	1.5	1.0
<b>1030HR-2S32</b>	2	30	32	70	150	1.5	0.8	
	2	30	32	120	200	1.5	1.0	
	2	30	32	180	300	1.5	1.5	

## Применяемые СМП

WDKT-MH



Тип	Обозначение	Тв. сплав с покрытием								Кермет			Тв. сплав				Стр.	
		NCM325	NCM335	NC5330	PC3500	PC5300	PC5400	PC3545	PC9530	PC6510	PD2000	CN2000	CN20	CN30	H01	G10		ST30A
08 Тип	WDKT080316ZDSR-MH				●	●	●	●	●									
10 Тип	WDKT10T320ZDSR-MH				●	●	●	●	●									

## Комплектующие



08 Тип	FTNA0306	-	-	-	TW09P
10 Тип	FTKA0408	CHH3.5R1	CTX03510	CR03	TW15S