


# IBE2000-T (Сферическая)

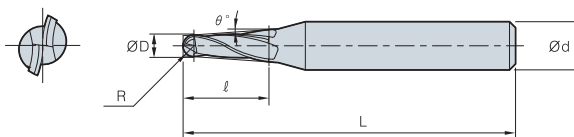

ØD	Предельные отклонения	Предельные отклонения R
Ø1.0 ~ Ø8.0	0 ~ -0.020	±0.01
Ø9.0 ~ Ø10.0	0 ~ -0.025	±0.01
Ø12.0 ~ Ø20.0	0 ~ -0.030	±0.01

Обозначение		R	ØD	Ød	ℓ	L	θ°
IBE	2060-050-T25	3	6	8	15	50	2.5°
	2060-050-T30	3	6	8	15	50	3°
	2080-060-T05	4	8	10	20	60	0.5°
	2080-060-T10	4	8	10	20	60	1°
	2080-060-T15	4	8	10	20	60	1.5°
	2080-060-T20	4	8	10	20	60	2°
	2080-060-T25	4	8	10	20	60	2.5°
	2080-060-T30	4	8	10	20	60	3°
	2100-070-T05	5	10	12	25	70	0.5°
	2100-070-T10	5	10	12	25	70	1°
	2100-070-T15	5	10	12	25	70	1.5°
	2100-070-T20	5	10	12	25	70	2°
	2100-070-T25	5	10	12	25	70	2.5°
	2100-070-T30	5	10	14	25	70	3°
	2110-070-T05	5.5	11	12	25	70	0.5°
	2110-070-T10	5.5	11	12	25	70	1°
	2110-070-T15	5.5	11	14	25	70	1.5°
	2110-070-T20	5.5	11	14	25	70	2°
	2110-070-T25	5.5	11	14	25	70	2.5°
	2110-070-T30	5.5	11	14	25	70	3°
	2120-075-T05	6	12	14	30	75	0.5°
	2120-075-T10	6	12	14	30	75	1°
	2120-075-T15	6	12	14	30	75	1.5°
	2120-075-T20	6	12	14	30	75	2°
	2120-075-T25	6	12	16	30	75	2.5°
	2120-075-T30	6	12	16	30	75	3°
	2130-075-T05	6.5	13	14	30	75	0.5°
	2130-075-T10	6.5	13	14	30	75	1°
	2130-075-T15	6.5	13	16	30	75	1.5°
	2130-075-T20	6.5	13	16	30	75	2°
	2130-075-T25	6.5	13	16	30	75	2.5°
	2130-075-T30	6.5	13	16	30	75	3°
2140-080-T05	7	14	16	35	80	0.5°	
2140-080-T10	7	14	16	35	80	1°	
2140-080-T15	7	14	16	35	80	1.5°	
2140-080-T20	7	14	18	35	80	2°	
2140-080-T25	7	14	18	35	80	2.5°	
2140-080-T30	7	14	18	35	80	3°	
2150-080-T05	7.5	15	18	35	80	0.5°	
2150-080-T10	7.5	15	18	35	80	1°	
2150-080-T15	7.5	15	18	35	80	1.5°	
2150-080-T20	7.5	15	18	35	80	2°	
2150-080-T25	7.5	15	20	35	80	2.5°	
2150-080-T30	7.5	15	20	35	80	3°	
2160-090-T05	8	16	20	40	90	0.5°	
2160-090-T10	8	16	20	40	90	1°	
2160-090-T15	8	16	20	40	90	1.5°	
2160-090-T20	8	16	20	40	90	2°	
2160-090-T25	8	16	20	40	90	2.5°	
2160-090-T30	8	16	20	40	90	3°	

(MM)