


IRE4000 (Радиусные вершины)

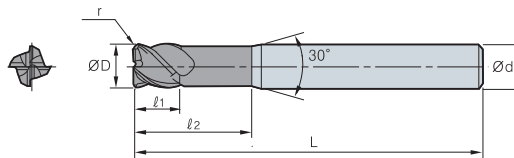

ØD	Предельные отклонения
Ø1.0 ~ Ø8.0	0 ~ -0.020
Ø0.5 ~ Ø10.5	0 ~ -0.025
Ø12.0 ~ Ø20.0	0 ~ -0.030

(мм)

Обозначение	ØD	Ød	ℓ1	ℓ2	L	r
IRE 4030-050-R03	3	6	12	14	50	0.3
4040-050-R03	4	6	15	16	50	0.3
4040-050-R05	4	6	15	16	50	0.5
4050-060-R03	5	6	15	16	60	0.3
4050-060-R05	5	6	15	16	60	0.5
4060-060-R03	6	6	20	-	60	0.3
4060-060-R05	6	6	20	-	60	0.5
4060-060-R10	6	6	20	-	60	1
4080-070-R03	8	8	25	-	70	0.3
4080-070-R05	8	8	25	-	70	0.5
4080-070-R10	8	8	25	-	70	1
4080-070-R15	8	8	25	-	70	1.5
4080-070-R20	8	8	25	-	70	2
4100-090-R03	10	10	30	-	90	0.3
4100-090-R05	10	10	30	-	90	0.5
4100-090-R10	10	10	30	-	90	1
4100-090-R15	10	10	30	-	90	1.5
4100-090-R20	10	10	30	-	90	2
4120-090-R05	12	12	30	-	90	0.5
4120-090-R10	12	12	30	-	90	1
4120-090-R15	12	12	30	-	90	1.5
4120-090-R20	12	12	30	-	90	2
4160-110-R05	16	16	50	-	110	0.5
4160-110-R10	16	16	50	-	110	1
4160-110-R15	16	16	50	-	110	1.5
4160-110-R20	16	16	50	-	110	2
4200-110-R05	20	20	55	-	110	0.5
4200-110-R10	20	20	55	-	110	1
4200-110-R15	20	20	55	-	110	1.5
4200-110-R20	20	20	55	-	110	2

